

## TORLYS Cork Vista

### PART 1 – MATERIALS

#### 1.1 Pre-finished cork flooring, consisting of a

- 2.5 mm thick top layer
- 6.0 mm thick High-Density Fibreboard (HDF) core
- 1.0 mm thick agglomerated cork backing with Microban® treatment

#### 1.2 TORLYS Cork Vista flooring shall be:

- **Board Size:** 9.5 mm (T) x 194 mm (W) x 910 mm (L)
- **Type of Finishing:** Wear Resistant Polyurethane
- **Edge Type:** Bevel 4-sides
- **Type of Decorative Top Layer:** Natural cork veneer
- **Type of Core:** High Density Fibreboard (HDF)
- **Type of Backing:** Blue CorkPlus agglomerated cork with Microban®
- **Assembly System:** Uniclic®, Glueless
- **Colours:** As selected by the Architect
- **Type of Installation:** Floating or glue



#### 1.3 Accessories: *see website for detailed pictures*

- **TORLYS Smart Trim** - Digital printed trim, 1930mm Long. Used as a transition between rooms / at doorways.
- **Smart-step** square nose stair moulding – Indent / made to order
- **Colours:** As selected by the architect

#### 1.4 Qualities

- Stunning visuals in traditional cork patterns
- Great for acoustics and people with allergies.
- Transition-Free up to 15m x 15m – float or glue
- Industry leading glue less locking system by Uniclic®
- 4-sided bevel edge

#### 1.5 Better Performance

- TORLYS Maxx Finish offers stain and wear resistance with an antimicrobial surface
- Smart engineering guarantees durability, ensuring your floor will never need refinishing
- CorkPlus™ Blue attached underlay with Microban® antimicrobial product protection
- Suitable for use over underfloor heating
- FloorScore Equivalent

## 1.6 More Sustainable

- Plastic Free - 100% natural product
- Being a natural product, we recommend sun filters on windows to reduce fading
- FSC® Certified
- Made without cutting down any cork oak trees, ensuring forests remain undamaged
- TORLYS Bulldog™ enables single planks of Cork Vista to be replaced, quickly and easily. No mess, no dust, no downtime

## PART 2 – PACKAGING INFORMATION

- **Pieces per carton:** 9 pieces
- **Square meters per carton:** 1.588 m<sup>2</sup>
- **Weight per Carton:** 13.1 kg

## PART 3 – EXECUTION

### 3.1 Site Verification of Conditions and Preparation:

- Repair any defects in the subfloor.  
All subfloors must be clean, firm, flat - as per NZ Building Code (within 3mm over 3m), dry (on concrete ≤ 75% RH as per ASTM F2170, on plywood 12% or less) and smooth
  - FLC – Floor leveling compound may be required to meet floor tolerances or repair sub-floor
  - Planks can be laid over any solid and stable subfloor material that meets these requirements. It is essential that the crawl space under wood subfloors is sufficiently ventilated. Remove any obstacles and provide sufficient ventilation. A 0.15mm poly vapour barrier must be installed on crawlspace floor
- Remove existing carpet, skirtings, trims and thresholds. Undercut door jambs, using a piece of flooring material as a guide. Repair all defects in the sub-floor. Additional expansion can be achieved by undercutting gib board.
- 
- Remove existing flooring if relevant and undercut door jambs, using a piece of flooring material as a guide
  - Additional expansion can be achieved by undercutting drywall
  - Check that the doors can still open and close after installing the floor
  - Doors may have to be cut to supply sufficient clearance
  - The door jambs may need to be undercut or replaced to install the floor under them
  - For aesthetic appearance we suggest that you dry-lay the material across the width of the room to ensure that the pieces of the last row are no less than 7.5cm wide
- The floor should be installed from several cartons at the same time, shuffling planks to insure colour and shade mix. If possible, lay the planks parallel to the source of light. The ideal environment is a temperature of 16°C - 21°C and relative humidity of 40 - 60%

### 3.2 Installation

- Prepare the subfloor. TORLYS Cork Vista has a built-in cork backing and therefore Torlys 0.15mm polyethene underlay is mandatory as a vapour barrier over concrete sub-floors
- When installing TORLYS Cork Vista first cover the sub-floor with 0.15mm poly, overlap edges by 30cm, damp-proof tape the seams and run up each wall. The use of 0.15mm poly is recommended for all installations (over wood or concrete sub-floors), as in case a repair is needed, the poly will make it easier to disassemble the floor
- Wood is the primary component of TORLYS Cork Vista flooring. Since the humidity of a room can vary from one season to the next, the floor must be able to expand and contract in ALL directions. A minimum of **13mm** expansion gap must be provided at all walls and vertical obstructions (around pipes etc) to allow for proper expansion/contraction space, under the skirtings. The gib may need to be undercut to get this expansion gap, if skirting is not thick enough. Install the planks in the same direction as the longest wall, or the same direction in which the light falls, for a more appealing look. Begin installing the floor from the left corner of the room
- Detailed installation instructions are included on the packaging and can also be downloaded at [www.torlys.co.nz](http://www.torlys.co.nz)

### 3.3 Preventative Maintenance

To ensure the full benefit of your **TORLYS Cork Vista** floor and to extend its beauty for years to come, we recommend the following preventative maintenance suggestions:

- Install floor protectors on furniture legs to protect against scratches and dents. These furniture pads should have no wrinkles and be made of soft, non-staining material (e.g. felt pads); the felt pads should be of adequate size to support the weight of the furniture and a minimum of 2.5 cm in diameter. The floor protectors should sit flat on the floor and be inspected periodically for cleanliness and wear. For heavy pieces of furniture (e.g. couches) the use of coaster-cups is recommended. Chair mats for hard-surface floors are also recommended
- Do not drag furniture or other heavy objects on the floor. Avoid high heels or shoes that need repair. Some types of high heel shoes can severely damage the surface of any floor covering. For minor scratch repairs, a touch-up kit is available at your TORLYS Dealer. For damages that require plank replacement, the TORLYS Bulldog™ tool, is also available through your dealer
- Close your curtains or blinds where continuous or extreme sunlight will shine on your floor. Also UV protection in windows will help with the performance of your furnishings. A combination of heat and sunlight can cause most furnishings and flooring to fade or change colour
- Sweep and vacuum floor regularly. Use correct hard surface vacuum tools. **DO NOT** use rotating beater bars, floor scrubbers, steamers, jet mops, buffers or similar products. Wipe up spills immediately. **DO NOT** allow topical moisture to remain on the floor longer than the time specified in the product warranty
- Avoid sand and grit build up
- At doorways and areas of heavy wear, use protective mats or rugs that are marked “non-staining”. For dry maintenance, use a dust mop, vacuum cleaner or dry cloth. For damp maintenance, **use the TORLYS EcoCare Cleaning Kit**, available from your Authorised Dealer, and follow the maintenance instructions on the container
- Never wax or use oil-based products on your **TORLYS Cork Vista** floor
- **Basic cleaning is with a clean damp cloth** (*cloth must not have been used with chemicals previously*)

**IMPORTANT:** Some species of cork are sensitive to light. It is natural for their colour to darken or lighten over time.

**IMPORTANT: To keep your warranty valid, use TORLYS recommended maintenance products and follow TORLYS maintenance instructions. For more information on maintenance products and instructions go to: [www.torlys.co.nz](http://www.torlys.co.nz)**

**Maintain the humidity level at 40 – 60%.** Certain regions within New Zealand have extreme changes in humidity levels, which may affect all natural floors. To maintain humidity within a healthy range, a humidifier or dehumidifier may be required. Gapping can occur in natural floors with seasonal fluctuations and when in extremely dry conditions (Low R.H.)

### 3.4 Cleaning

- Dust mop or vacuum with bristles down regularly to remove loose soil. Clean as required with the TORLYS Cleaning Kit
- Torlys Cleaner must be used to maintain warranty.
- Detailed maintenance information can be accessed at [www.torlys.co.nz](http://www.torlys.co.nz)

### ASTM and ANSI Product Performance Tests

Standard	Description	Test Result	Notes
ASTM E648	Critical Radiant Flux	Average Critical Radiant Flux: 0.28 W/cm <sup>2</sup>	(NFPA 101 Classification: Class 2)
ASTM E662	Optical Density of Smoke	Pass ≤450	
ASTM E84	Surface Burning	Flame Spread Index: 20 Smoked-Developed Index: 60	(ASTM E84 Class A)
AATCC 30-III (TM 30-III Aspergillus Niger)	Antifungal Assessment and Mildew Resistance Test	Pass = Not supportive of fungal growth	
ANSI A137.1-2012 (aka DCOF AcuTest)***	Coefficient of Friction (Floor Slip Resistance)	Average DCOF (wet): 0.48	
ASTM F970	Static Load Limit / Residual Indentation @ 250 PSI Static Load Limit / Residual Indentation @ 1000 PSI	0.008 inch 0.023 inch	
ASTM D2394	Falling Ball Indentation Test @ 72 Inches Drop	0.014 inch = no Fracture of surface or interior material	
ASTM F1914	Short Term Indentation and Residual Indentation	Residual Indentation @ 75 lbs: 0.011 inch	
EN 14354:2017	Determination of the Wear Resistance Using the Falling Sand Method	> 6000 revolutions	
ASTM C518	Thermal Resistance - Imperial Units Thermal Resistance - SI Units	0.508 °F-ft <sup>2</sup> h/BTU 0.0894 (m <sup>2</sup> K)/W	
ASTM F925	Resistance to Chemicals	0 = No Change*	*(11 of 12 chemicals)
ASTM F1515	Resistance to Light	Gray Scale Rating: 1	(Test result after 300 hours exposure)
ASTM E492-09 (2016)e1 / ASTM E989 - 18	Impact Insulation Class	IIC 71	
ASTM E90-09 (2016) / ASTM E413 - 10	Sound Transmission Coefficient	STC 64	
ASTM E2179	Delta IIC	22	

# A Cleaner Floor Starts Here.

Contribute to a cleaner home with built-in antimicrobial protection.

TORLYS Maxx Commercial Finish with built-in antimicrobial protection will keep your floors 99% cleaner between cleanings, 24/7.

For more information, visit [torlys.co.nz](https://torlys.co.nz)




## Warranty

25-Year Residential Limited Warranty\*

15-Year Commercial Limited Warranty\*

\*Visit [torlys.co.nz/warranty](https://torlys.co.nz/warranty) for details.

## How It's Made

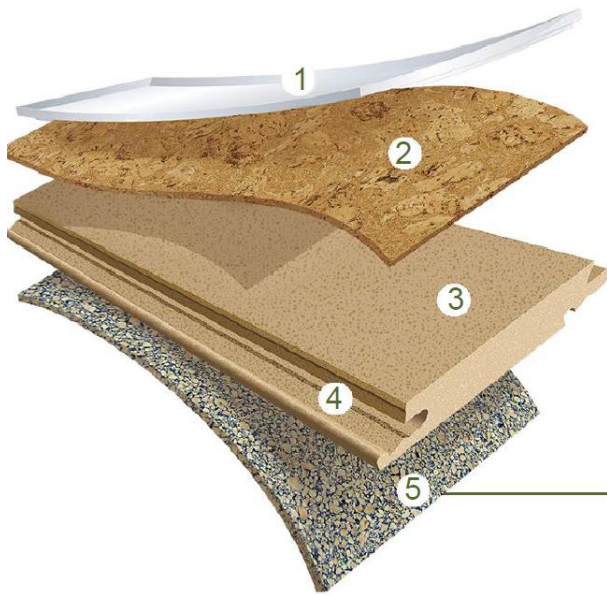

1. TORLYS Maxx Finish (Antimicrobial | Anti-Wear)
2. 2.5mm Cork Layer cork layer
3. Low swell TORLYS™ Smart Core with dent resistance and dimensional stability
4. Uniclic® joint. The most advanced, gap-resistant joint system available today
5. TORLYS CorkPlus™ Blue underlayment with Microban® antimicrobial product protection

MADE IN PORTUGAL

**TORLYS**  
smart floors

Visit our website <https://torlys.co.nz> for more information